

**Heat Exchanger.** Check out the main heat exchanger by removing the end covers and looking through the tubes with a light. If necessary flush with water or remove for more detailed cleaning. Projected life in salt water is 2000 hours, but it is impossible to predict exactly due to other variance of conditions such as electrolysis and sand wear.


Suggest carry a spare after 2000 hours or if cruising in remote areas.

**Lehman 120 822-0211 Exchanger (copper)** price \$426.00

**Lehman 120 822-0218 Exchanger (CuNi)** price \$582.50

**Lehman 80 822-0213 Exchanger (copper)** price \$356.49

**Lehman 80 822-0219 Exchanger (CuNi)** price \$468.00

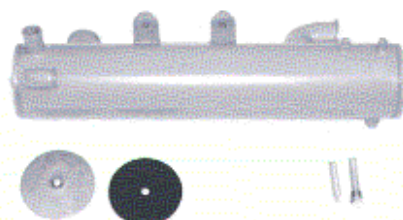


**Exhaust Elbow.** Replace the exhaust elbow before the bottom blows out as shown on the attached photo. The standard 810-0371 Lehman 120 elbow has a 3.5" O.D. hose bib for attachment of the exhaust hose. Lehman 80 engines used the 810-0372 Elbow supplied with a 3" O.D. hose bib. It is OK to use the 3.5" on a four cylinder. Some installations require the 810-0283, 3" female pipe thread elbow for installation of a 90 degree sweep fitting.

**810-0371 Exhaust Elbow, 3.5" Bib** price \$125.00

**510-0301 Elbow Kit, w/gasket, elbow & bolts** price \$130.00

**L1A372 Exhaust Elbow, 3" Bib** price \$280.00

**810-0283 Exhaust Elbow, 3 F Pipe Thread** price \$200.00

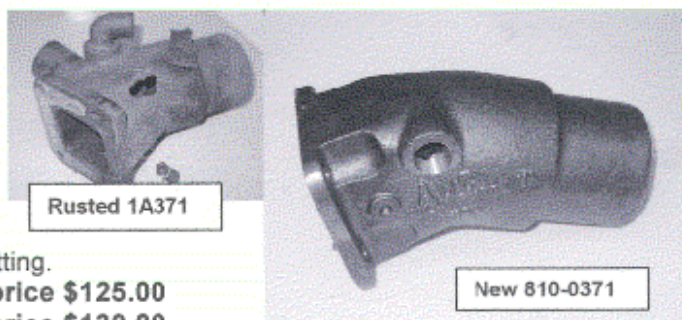

**Oil Change Hose Kit.** Install our oil drain kit in place of the original oil pan drain plug. This kit makes the chore of removing oil a snap. It pulls all oil from the pan in a matter of minutes, with either a hand or electrical pumps. Ask about our electrical oil change packages, available for permanent installation.


**510-1020 Oil Drain Kit** price \$43.11

**Electric Stop Kit.** Replace the old box type electric stop with the new stronger style unit. You may purchase the complete assembly with mounting bracket, or only the solenoid and connection link. To use your bracket, you will need to position and drill two mounting holes in the original bracket.

**510-0530 Electric Stop Kit complete w/ Bracket** price \$107.00


**824-0211 Solenoid only** price \$ 58.25

**833-9530 Connection Link** price \$ 10.20

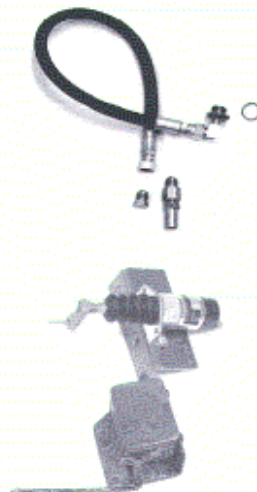

**Drive Damper.** Inspect your drive damper if you have more than 2500 hours on the engine. This could be a difficult or easy job depending upon where the rear engine supports are mounted to the engine or the transmission. If mounted on the transmission, a means to support the back of the engine must be devised. Contact us for guidance on how to best handle your inspection.

**830-0007 Drive Damper (Lehman 80 & 120)** price \$125.00

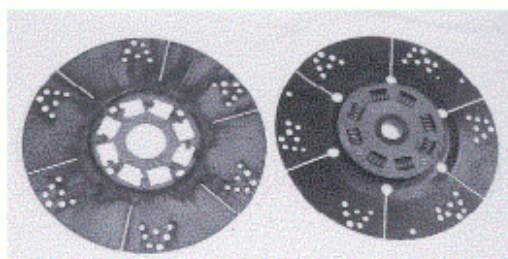

**Note: All prices are subject to change without notice.**

**AMERICAN DIESEL CORP, PO Box 1838, Kilmarnock, VA 22482**  
**Phone: 804-435-3107, Fax: 888-474-2929**